

CUSTOMER #: 1716
UNIT# 70

9371D



INVOICE

Ogden Peterbilt, Inc.

RICH GRANT INC
910 WEST 24TH STREET
OGDEN, UT 84401

DUPLICATE 1
PAGE 2

735 N. 2000 W.
Marriott-Slaterville, Utah 84404

P.O. Box 27634
Salt Lake City, Utah 84127
Phone (801) 486-8781

HOME: CONT: 801-621-7370
BUS: 801-621-7370 CELL:

SERVICE ADVISOR: 2206 Christina Vandeput

COLOR		YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN/ OUT		TAG
		16	KENWORTH W900		1XKWD49X6GR101186			519074/519074		T70
DEL DATE		PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
28JUN15 DD				23:00 02FEB21		NEED	0.00	CHG	11FEB21	
R.O. OPENED			READY		OPTIONS:		DLR:P250 ENG:79834574			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
		TECH TECHNOLOGY FEE					
		999	C	0.00			
SUBL	FLYWHEEL	PO#815838	C			50.00	50.00
LUBE	ENGINE OIL	C				115.00	115.00
MISC	ROLOC WHEELS	C				176.50	176.50
						15.00	15.00

519074 SWAPPED ENGINE WITH NEW COMPLETE.
CUSTOMER REQUEST TO REPLACED THE ENGINE. JACKED THE TRUCK UP AND PLACED IT ON JACK STANDS. RECOVERED 3 LBS OF FREON. REMOVED THE FAN AND SHROUD. UNBOLTED THE CLUTCH, REMOVED THE CROSS MEMBER UNDER THE TRANSMISSION. PLACED THE JACK UNDER THE TRANSMISSION. DRAINED THE COOLANT. REMOVED ALL CONNECTED COOLANT LINES. LOOSENEED THE RADIATOR AND LEANED IT FORWARD. HAD TO REMOVE THE HOOD GUIDE ON THE PASS SIDE, MARKED THE ALIGNMENT. UNBOLTED THE TRANSMISSION. REMOVED THE TURBO DOWN PIPING. REMOVED ALL THE INTAKE PLUMBING AND UNIDID AND CLEANED ALL THE JOINTS. FOUND THE DRIVER SIDE AIR FILTER CANISTER LID TO BE THE WRONG TYPE. INFORMED CUSTOMER AND AND THEY AGREED TO ORDER THE CORRECT ONE. DISCONNECTED THE BATTERIES. REMOVED THE STARTER AND DISCONNECTED THE CHASSIS SIDE HARNESS. REMOVED THE ALTERNATOR AND A/C COMPRESSOR. UNBOLTED THE ENGINE AND REMOVED IT. FOUND THE CLUTCH AND INPUT SHAFT WERE NOT REUSABLE, CUSTOMER AGREED TO REPLACE THEM. SENT THE FLYWHEEL TO BE TURNED AND INSTALLED A NEW PILOT BEARING. INSTALLED THE SUITCASE KIT WITH A NEW ONE PIECE CLUTCH BRAKE. MOVED ALL THE FITTINGS AND MOUNTS OVER TO THE NEW ENGINE, REAR MOTOR MOUNTS SHOW NO SIGNS OF FAILURE. INSTALLED WITH NEW GASKETS. HAD TO TORCH OFF THE OLD FRONT MOUNTS. INSTALLED THE ENGINE AND THE NEW MOUNTS. TORQUED THE MOUNTS AND BOLTED THE TRANSMISSION UP. INSTALLED ALL THE CLUTCH BOLTS. HAD TO ADJUST THE CLUTCH LINKAGE. INSTALLED ALL REMOVED COMPONENTS. FILLED WITH COOLANT, INSTALLED NEW RADIATOR HOSES, TORQUED THE CLAMPS TO SPEC. FILLED WITH 3 LBS OF FREON. FILLED WITH 44 QUARTS OF 15W40 ENGINE OIL. INSTALLED THE POWER STEERING PUMP. INSTALLED THE HOOD GUIDE AND INSTALLED THE RADIATOR SUPPORT ARMS. TESTED OLD COOLANT FOUND TO BE

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

CUSTOMER COPY

